


Global Suppliers of Measurement and Protection Equipment for Industry

Eltime Controls

Hall Road Maldon Essex CM9 4NF T +44 (0)1621 859500 F +44 (0)1621 855335 E sales@eltime.co.uk www.eltime.co.uk

Calibration Instructions for FPM482 Digital Panel Meter (Except 4-20mA)

- 1. Unclip bezel and remove the front lens from the panel meter.
- 2. Select the decimal point position (if required) by repositioning the jumper in position D1, D2 or D3 (see table below).

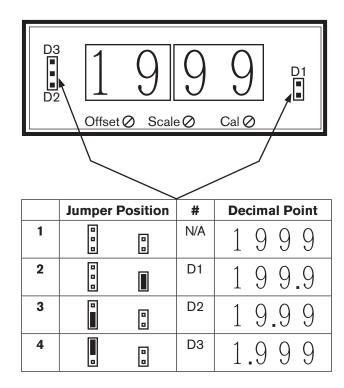

- 3. Connect the auxiliary power supply to terminals 6 and 8 on the panel meter and switch on for at least 3 minutes.
- 4. With no input signal being measured, check the display is reading zero. If necessary, adjust the multiturn potentiometer marked 'Offset' until zero reading is displayed.
- 5. Inject full scale input into terminals 1(+/~) and 3(-/~) and adjust the multiturn potentiometer marked 'Scale' until display reads the full range required. Fine adjustment of the full scale reading can be made by adjusting the multiturn potentiometer marked 'Cal'.
- 6. Check the meter calibration at zero, half scale and full scale and repeat steps 4 and 5 above if necessary.
- 7. Replace the front lens and bezel.




Global Suppliers of Measurement and Protection Equipment for Industry

Eltime Controls

Hall Road Maldon Essex CM9 4NF T +44 (0)1621 859500 F +44 (0)1621 855335 E sales@eltime.co.uk www.eltime.co.uk

Calibration Instructions for FPM964 Digital Panel Meter (Except 4-20mA)

- 1. Remove the front lens from the panel meter.
- 2. Select the overall display range. This is done by repositioning the ratio jumpers JC1 and JC2 (see tables below).

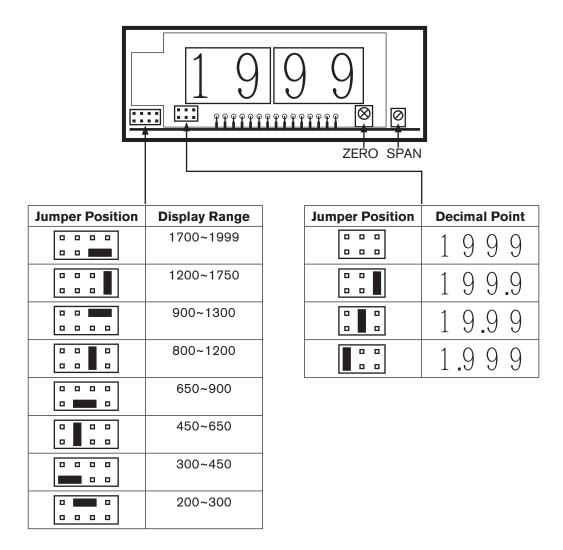

- 3. Connect the auxiliary power supply to the panel meter and switch on for at least 3 minutes.
- 4. With no input signal being measured, check the display is reading zero. If necessary, adjust the single turn potentiometer marked 'ZERO' until zero reading is displayed.
- 5. Inject full scale input into terminals 1(+/~) and 3(-/~) and adjust the multiturn potentiometer marked 'SPAN' until display reads the full range required.
- 6. Check the meter calibration at zero, half scale and full scale and repeat steps 4 and 5 above if necessary.
- 7. Replace the front lens.